

## Menu

HISTORY FILE MAP for year 2008

REALTIME


PLAYBACK

RECALLED REALTIME

RECALLED PLAYBACK

043.18:16-18:41 25 mins of realtime 128 bps telemetry lost on DSS-24 due to suspected RFI. DR G108341 refers.

044.09:29-09:50 21 mins of realtime 128 bps telemetry lost on DSS-14 due to incorrect setting of subreflector controller assembly. DR G108344 refers.

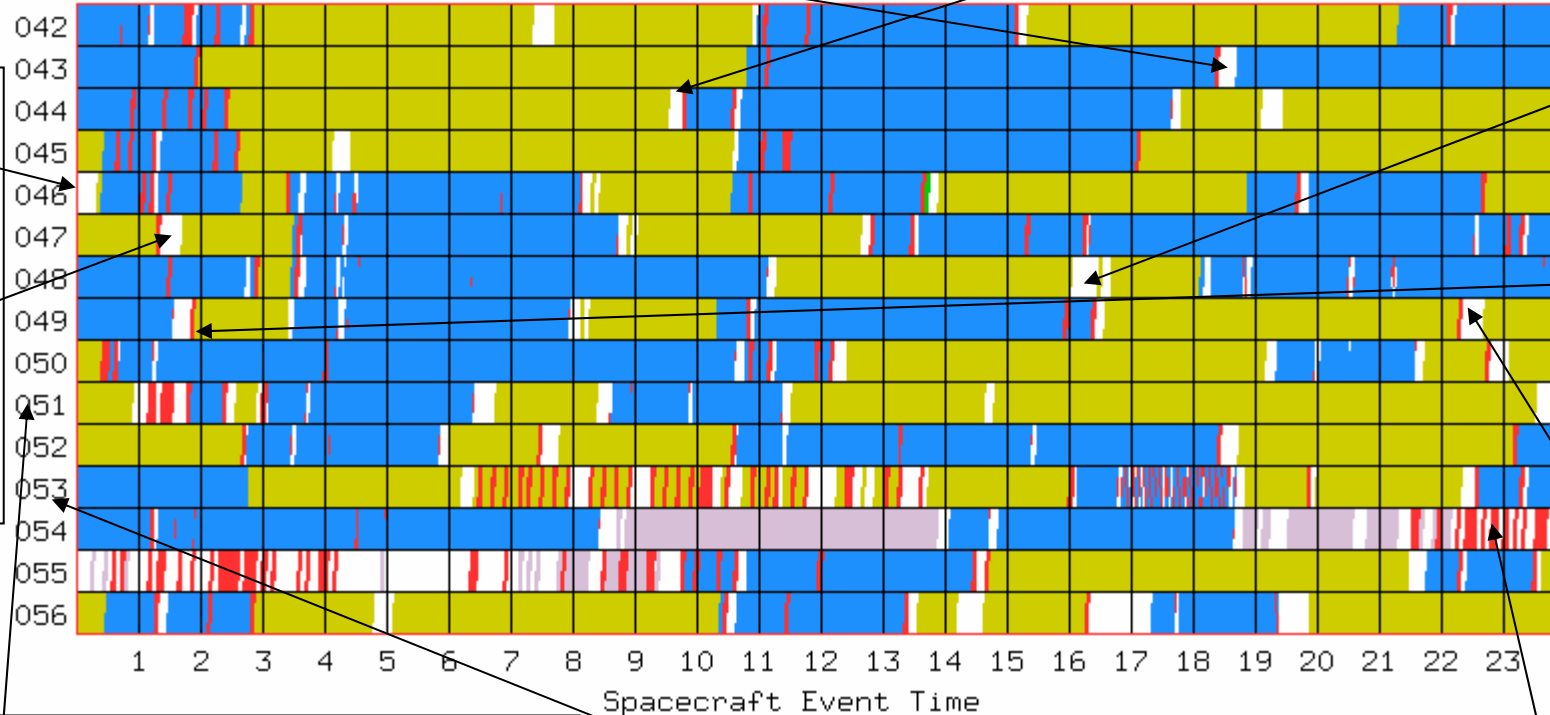

048.15:57-16:40 43mins of recorded 128 bps telemetry lost due to data hit during playback on DSS-14. No DR.

049.01:32-01:59 27mins of recorded 128 bps telemetry lost due to data hit during playback on DSS-63. No DR.

049.22:10-22:40 30mins of recorded 128 bps telemetry lost due to data hit during playback on DSS-63. No DR.

045.23:48-00:14 26mins of recorded 128 bps telemetry lost due to data hit during playback on DSS-63. No DR.

047.01:12-01:41 29mins of recorded 128 bps telemetry lost due to data hit during playback on DSS-63. No DR.

051.00:50-01:50 1hr of real time 128 bps telemetry lost due to low SNR following inability to command to nominal mod index during DSS-14 pass on DOY 50. DR N104746 refers.

051.06:21-06:40 19mins of recorded 128 bps telemetry lost due to data hit during playback on DSS-14. No DR.

051.08:25-08:36 11mins of real time 1024 bps telemetry lost due to late AOS following recalibration of transmitter on DSS-14. DR G108368 refers.

051.23:27-23:57 30mins of recorded 128 bps telemetry lost due to data hit during playback on DSS-63. No DR.

053.04:07-04:49 42mins of realtime 128 bps telemetry lost due to low elevation on DSS-24. No DR.

053.06:27-13:34 7hr 7mins of recorded 128 bps TM intermittent due to unresolved issue on DSS-14. Problem may be due to fixed subreflector. Issue currently being investigated and documented using DR G108374.

053.16:45-18:25 1hr 40mins of realtime 1024 bps INT TM intermittent due to unresolved issue on DSS-14. DR G108374.

054.21:31-055.09:48 12hr 17mins of recorded 128 bps telemetry lost or intermittent due to low SNR at DSS-14 during playback on DOY 060.